

Brush Motor Belt Replacement Kit

T500, T500e, Speed Scrub 500 Cylindrical Brush Models



INSTALLATION INSTRUCTIONS:

Installation Time: .5 Hours

Special Tools Required: T- 25 Torque Screwdriver,
Belt Installation Tool (supplied with kit)

FOR SAFETY: Before servicing machine, stop on level surface, turn off machine, remove key and set parking brake if equipped.

1. Remove the two skirt covers and belt cover from scrub head (Figure 1).

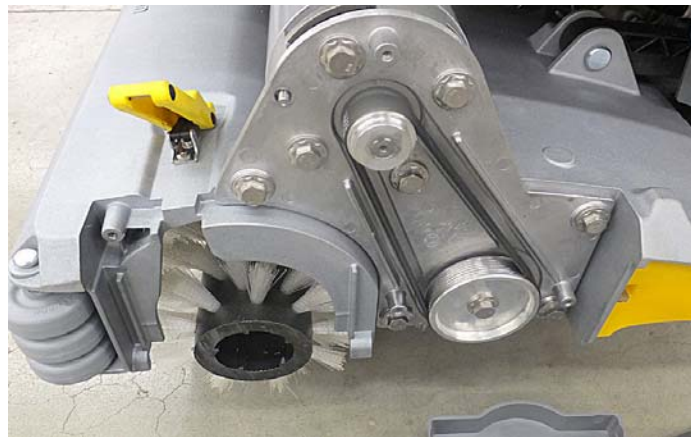


FIG. 1

2. Remove the M8 hex screw from lower sheave, 13mm socket wrench required. Attach the supplied belt tool to sheave with M8 hex screw as shown (Figure 2)



FIG. 2

9015765 Kit Contents

Part No.	Description	Qty.
1035888	Brush Motor Belt	2
1203758	Belt Installation Tool	1



3. To remove the old belt, slowly turn the belt tool clockwise with a 13mm socket wrench while pulling the belt away from the sheave as shown (Figure 3).



FIG. 3

4. To install a new belt, slowly turn the belt tool clockwise to guide the belt over the sheave as shown. Make sure the belt is completely seated into the grooves on both the upper and lower sheaves.

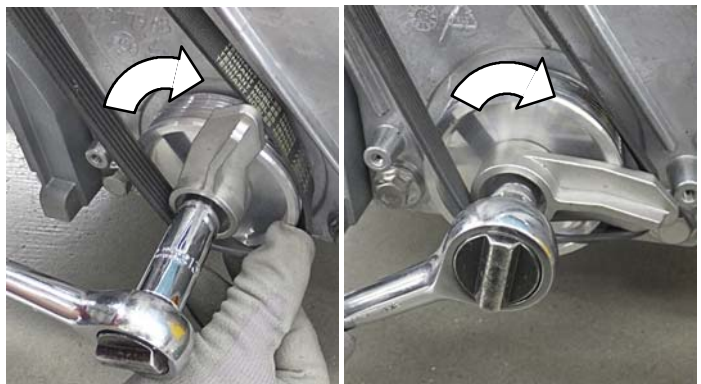


FIG. 4

5. Remove the belt tool from the sheave and replace the 8M hex screw.
6. Reinstall belt cover and skirt covers.